

Agilent E4981A Capacitance Meter

Data Sheet





Definitions

This document provides specifications and supplemental information for the Agilent E4981A capacitance meter. All specifications apply to the conditions of a 0 °C to 45 °C temperature range, unless otherwise stated, and 30 minutes after the instrument has been turned on.

Definitions

Specification (spec.): Warranted performance. Specifications include guard bands to account for the

expected statistical performance distribution, measurement uncertainties, and

changes in performance due to environmental conditions.

Supplemental information is intended to provide information that is helpful for

using the instrument but that is not guaranteed by the product warranty.

Typical (typ.): Describes performance that will be met by a minimum of 80% of all products. It is

not guaranteed by the product warranty.

Nominal (nom.): A general descriptive term that does not imply a level of performance.

Option dependencies The available frequency is defined as follows.

E4981A-001: 120 Hz/1 kHz/1 MHz/1 MHz ± 1%/1 MHz ± 2%

E4981A-002: 120 Hz/1 kHz

The information regarding "Frequency 1 MHz/1 MHz \pm 1%/1 MHz \pm 2%" in specifications, supplemental and general information in not valid for the

E4981A-002.

Basic specifications

Measurement parameters

- Cp-D, Cp-Q, Cp-Rp, Cp-G
- Cs-D, Cs-Q, Cs-Rs

where

Cp: Capacitance value measured using the parallel equivalent circuit model

Cs: Capacitance value measured using the series equivalent circuit model

D: Dissipation factor

Q: Quality factor (inverse of D)

G: Equivalent parallel conductance measured using the parallel equivalent circuit model

Rp: Equivalent parallel resistance measured using the parallel equivalent circuit

Rs: Equivalent series resistance measured using the series equivalent circuit model

2

Specifications Measurement

Measurement signals

Frequency	Allowable frequencies	120 Hz 1 kHz 1 MHz 0.98 MHz (1 MHz – 2%) 0.99 MHz (1 MHz – 1%) 1.01 MHz (1 MHz + 1%) 1.02 MHz (1 MHz + 2%)
	Accuracy	±0.02%
Level	Range	0.1 V to 1 V
	Resolution	0.01 V
	Accuracy	±5%
Output mode	Continuous or Synchronous	
Source delay time ¹	Range	0 to 1 s
	Resolution	0.1 ms

^{1.} Source delay time is effective when output mode is set to Synchronous mode.

Measurement c	able length	s:
---------------	-------------	----

0 m, 1 m, 2 m

Measurement time selection:

5 speeds measurement time mode N = 1, 2, 4, 6, 8

For information on the measurement time in each mode, refer to Table 15

"Measurement time."

Measurement range selection:

Auto, Hold

Measurement range:

Measurement signal frequency:	10 nF	22 nF	47 nF	100 nF
120 Hz	220 nF	470 nF	1 μF	2.2 μF
	4.7 μF	10 μF	22 μF	47 μF
	100 μF	220 μF	470 μF	1 mF
Measurement signal frequency:	100 pF	220 pF	470 pF	1 nF
1 kHz	2.2 nF	4.7 nF	10 nF	22 nF
	47 nF	100 nF	220 nF	470 nF
	1 μF	2.2 μF	4.7 μF	10 μF
	22 μF	47 μF	100 μF	•
Measurement signal frequency:	1 pF	2.2 pF	4.7 pF	10 pF
1 MHz / 1 MHz ± 1% / 1 MHz ± 2%	22 pF	47 pF	100 pF	220 pF
	470 pF	1 nF		r

For information on measurable range in each measurement mode, refer to "Available measurement ranges" (Tables 2 through 4).

Averaging:

Range	1 to 256 measurements
Resolution	1

Trigger mode:

Internal trigger (Int), Manual trigger (Man), External trigger (Ext), GPIB/USB/LAN trigger (Bus)

Trigger delay time:

Range	0 to 1 s
Resolution	0.1 ms

Measurement display ranges

Table 1 shows the range of the measured value that can be displayed on the screen.

Table 1. Allowable measured value display range

Parameter	Measurement display range
Cs, Cp	±1.000000 aF to 999.9999 EF
D	±0.000001 to 9.999999
0	±0.01 to 99999.99
Rs, Rp	± 1.000000 a Ω to 999.9999 $E\Omega$
G	±1.000000 aS to 999.9999 ES
Δ%	±0.0001 % to 999.9999 %

a: 1 x 10⁻¹⁸, E: 1 x 10¹⁸

Available measurement ranges

Tables 2 through 4 show recommended measurement ranges (recommended for accurate measurement) and significant measurement ranges (ranges that do not cause overload) for each measurement value under the condition D (dissipation factor) ≤ 0.5 .

Table 2. Measurable capacitance ranges when measurement frequency is 120 Hz

Measurement range setting	Recommended measurement range	Significant measurement range
10 nF	0 F to 15 nF	0 F to 15 nF
22 nF	15 nF to 33 nF	0 F to 33 nF
47 nF	33 nF to 68 nF	0 F to 68 nF
100 nF	68 nF to 150 nF	0 F to 150 nF
220 nF	150 nF to 330 nF	0 F to 330 nF
470 nF	330 nF to 680 nF	0 F to 680 nF
1 μF	680 nF to 1.5μF	0 F to 1.5 μF
2.2 μF	1.5 μF to 3.3 μF	0 F to 3.3 μF
4.7 μF	3.3 μF to 6.8 μF	0 F to 6.8 μF
10 μF	6.8 μF to 15 μF	0 F to 15 μF
22 μF	15 μF to 33 μF	0 F to 33 μF
47 μF	33 μF to 68 μF	0 F to 68 μF
100 μF	68 μF to 150 μF	0 F to 150 μF
220 μF	150 μF to 330 μF	0 F to 330 μF
470 μF	330 μF to 680 μF	0 F to 680 μF
1 mF	680 μF to 2 mF	0 F to 2 mF

Available measurement ranges (continued)

Table 3. Measurable capacitance ranges when measurement frequency is 1 kHz

Measurement range setting	Recommended measurement range	Significant measurement range
100 pF	0 pF to 150 pF	0 F to 150 pF
220 pF	150 pF to 330 pF	0 F to 330 pF
470 pF	330 pF to 680 pF	0 F to 680 pF
1 nF	680 pF to 1.5 nF	0 F to 1.5 nF
2.2 nF	1.5 nF to 3.3 nF	0 F to 3.3 nF
4.7 nF	3.3 nF to 6.8 nF	0 F to 6.8 nF
10 nF	6.8 nF to 15 nF	0 F to 15 nF
22 nF	15 nF to 33 nF	0 F to 33 nF
47 nF	33 nF to 68 nF	0 F to 68 nF
100 nF	68 nF to 150 nF	0 F to 150 nF
220 nF	150 nF to 330 nF	0 F to 330 nF
470 nF	330 nF to 680 nF	0 F to 680 nF
1 μF	680 nF to 1.5 μF	0 F to 1.5 μF
2.2 μF	1.5 μF to 3.3μF	0 F to 3.3 μF
4.7 μF	3.3 μF to 6.8 μF	0 F to 6.8 μF
10 μF	6.8 μF to 15 μF	0 F to 15 μF
22 μF	15 μF to 33 μF	0 F to 33 μF
47 μF	33 μF to 68 μF	0 F to 68 μF
100 μF	68 μF to 200 μF	0 F to 200 μF

Available measurement ranges (continued)

Table 4. Measurable capacitance ranges when measurement frequency is 1 MHz, 1 MHz $\pm1\%$, 1 MHz $\pm2\%$

Measurement range setting	Recommended measurement range	Significant measurement range
1 pF	0 F to 1.5 pF	0 F to 1.5 pF
2.2 pF	1.5 pF to 3.3 pF	0 F to 3.3 pF
4.7 pF	3.3 pF to 6.8 pF	0 F to 6.8 pF
10 pF	6.8 pF to 15 pF	0 F to 15 pF
22 pF	15 pF to 33 pF	0 F to 33 pF
47 pF	33 pF to 68 pF	0 F to 68 pF
100 pF	68 pF to 150 pF	0 F to 150 pF
220 pF	150 pF to 330 pF	0 F to 330 pF
470 pF	330 pF to 680 pF	0 F to 680 pF
1 nF	680 pF to 1.5 nF	0 F to 1.5 nF

Measurement accuracy

The measurement accuracy is defined when all of the following conditions are met:

- · Warm-up time: 30 minutes or longer
- · Ambient temperature: 18 °C to 28 °C
- · Execution of OPEN Correction
- Execution of Cable Correction for 1 MHz measurement
- Measurement cable length: 0 m, 1 m, or 2 m (16048A/B/D)¹
- D (dissipation factor) ≤ 0.5

Accuracy of Cp, Cs, D, G, Rs, Q and Rp

Tables 8 through 13 show the measurement accuracy of Cp, Cs, and D when $D \le 0.1$.

Table 14 shows the formula of the measurement accuracy of G, Rs, Q and Rn when $D \leq 0.1$.

When $0.1 < D \le 0.5$, multiply the accuracy obtained in Tables 8 through 13 by the coefficient in Table 5.

Table 5. Dissipation factor Coefficient

Parameter	Coefficient
Cp, Cs, G, Rs ²	1 + D ²
D	1 + D

Table 6. Formula of the measurement accuracy of G, R_{s} , Q and R_{p}

Parameter	Formula	
G _e (G accuracy)	$(C_e/100) \times 2 \times \pi \times f \times C_x$	
Rs _e (R _s accuracy)	$(C_e/100) / (2 \times \pi \times f \times C_x)$	
Q _e (Q accuracy)	$\frac{\pm Qx^2 \times De}{1 \mp Qx \times De}$	
Rp _e (Rp accuracy)	$\frac{\pm Rpx^2 \times Ge}{1 \mp Rpx \times Ge}$	

C_a: Cp or Cs accuracy [%]

f: Measurement frequency [Hz]

C_x: Measurement value of Cp or Cs [F]

 $\mathbf{Q}_{\mathbf{x}}$: Measurement value of \mathbf{Q}

 $\mathbf{Rp}_{\mathbf{x}}$: Measurement value of Rp $[\Omega]$

De: D accuracy [%]

^{1.} The outer conductor resistance of cable requires the following condition. $16048A/B: 62 m\Omega$ or below 16048D: 90 $m\Omega$ or below

^{2.} If you select a secondary measurement parameter other than D, calculate D.

Accuracy when ambient temperature exceeds the range of 18 °C to 28 °C (typical)

When the ambient temperature exceeds the range of 18 $^{\circ}$ C to 28 $^{\circ}$ C, multiply the accuracy obtained above by the coefficient shown in the table below.

Table 7. Temparature Coefficient

	Coefficient
0 °C ≤ ambient temperature < 8 °C	3
8 °C ≤ ambient temperature < 18 °C	2
18 °C ≤ ambient temperature ≤ 28 °C	1
28 °C ≤ ambient temperature ≤ 38 °C	2
38 °C ≤ ambient temperature ≤ 45 °C	3

Accuracy when an Alternative Current magnetic field is applied

When an alternating current magnetic field is applied to the instrument. Multiply the accuracy obtained in Tables 8 through 13.

 $1+B \times (2+0.5 \times K)$

B: Magnetic flux density [Gauss]

Cx: Measured value of the capacitance (Cp or Cs),

Cr: A measurement range [F]

Vs: A measurement signal level [V].

In Tables 8 through 13, K is defined as follows:

 $Cx \le Cr$: $K = (1/Vs) \times (Cr/Cx)$

Cx > Cr: K = 1/Vs

where

Cx is measured value of the capacitance (Cp or Cs), Cr is a measurement range and Vs is a measurement signal level [V].

Measurement accuracy (continued)

Table 8. Measurement accuracy of Cp, Cs (measurement frequency: 120 Hz)

Cp, **C**s [%]

Measurement time mode (N)	1	2	4	6	8
10 nF 22 nF 47 nF 100 nF 220 nF 470 nF 1 µF 2.2 µF 4.7 µF 10 µF 22 µF 47 µF	0.055 + 0.030 × K	0.055 + 0.022 × K	0.055 + 0.018 × K	0.055 + 0.016 × K	0.055 + 0.015 × K
220 μF 470 μF 1 mF	0.4 + 0.060 × K	0.4 + 0.044 × K	0.4 + 0.036 × K	0.4 + 0.032 × K	0.4 + 0.030 × K

Table 9. Measurement accuracy of D (measurement frequency: 120 Hz)

D

Measurement time mode (N)	1	2	4	6	8
10 nF 22 nF 47 nF 100 nF 220 nF 470 nF 1 µF 2.2 µF 4.7 µF 10 µF 22 µF 47 µF	0.00035 + 0.00030 × K	0.00035 + 0.00022 × K	0.00035 + 0.00018 × K	0.00035 + 0.00016 × K	0.00035 + 0.00015 × K
220 μF 470 μF 1 mF	0.004 + 0.00060 × K	0.004 + 0.00044 × K	0.004 + 0.00036 × K	0.004 + 0.00032 × K	0.004 +0.00030 × K

Measurement accuracy (continued)

Table 10. Measurement accuracy of Cp, Cs (measurement frequency: 1 kHz)

Cp, Cs [%]

Measurement time mode (N)	1	2	4	6	8
100 pF	0.055 + 0.070 × K	0.055 + 0.047 × K	0.055 + 0.036 × K	0.055 + 0.033 × K	0.055 + 0.030 × K
220 pF	0.055 + 0.045 × K	0.055 + 0.032 × K	0.055 + 0.025 × K	0.055 + 0.022 × K	0.055 + 0.020 × K
470 pF 1 nF 2.2 nF 4.7 nF 10 nF 22 nF 47 nF 100 nF 220 nF 470 nF 1 μF 2.2 μF 4.7 μF 10 μF	0.055 + 0.030 × K	0.055 + 0.022 × K	0.055 + 0.018 × K	0.055 + 0.016 × K	0.055 + 0.015 × K
22 μF 47 μF 100 μF	0.4 + 0.060 × K	0.4 + 0.044 × K	0.4 + 0.036 × K	0.4 + 0.032 × K	0.4 + 0.030 × K

Table 11. Measurement accuracy of D (measurement frequency: 1 kHz)

D

Measurement time mode (N)	1	2	4	6	8
100 pF	0.00035 + 0.00070 × K	0.00035 + 0.00047 × K	0.00035 + 0.00036 × K	0.00035 + 0.00033 × K	0.00035 + 0.00030 × K
220 pF	0.00035 + 0.00045 × K	0.00035 + 0.00032 × K	0.00035 + 0.00025 × K	0.00035 + 0.00022 × K	0.00035 + 0.00020 × K
470 pF 1 nF 2.2 nF 4.7 nF 10 nF 22 nF 47 nF 100 nF 220 nF 470 nF 1 μF 2.2 μF 4.7 μF 10 μF	0.00035 + 0.00030 × K	0.00035 + 0.00022 × K	0.00035 + 0.00018 × K	0.00035 + 0.00016 × K	0.00035 + 0.00015 × K
22 μF 47 μF 100 μF	0.004 + 0.00060 × K	0.004 + 0.00044 × K	0.004 + 0.00036 × K	0.004 + 0.00032 × K	0.004 + 0.00030 × K

Measurement accuracy (continued)

Table 12. Measurement accuracy of Cp, Cs (measurement frequency: 1 MHz, 1 MHz \pm 1%, 1 MHz \pm 2%)

Cp, Cs [%]

Measurement time mode (N)	1	2	4	6	8
1 pF	0.055 + 0.070 × K	0.055 + 0.047 × K	0.055 + 0.036 × K	0.055 + 0.033 × K	0.055 + 0.030 × K
2.2 pF	0.055 + 0.045 × K	0.055 + 0.032 × K	0.055 + 0.025 × K	0.055 + 0.022 × K	0.055 + 0.020 × K
4.7 pF 10 pF 22 pF 47 pF 100 pF 220 pF 470 pF 1 nF	0.055 + 0.030 × K	0.055 + 0.022 × K	0.055 + 0.018 × K	0.055 + 0.016 × K	0.0 55 + 0.015 × K

Table 13. Measurement accuracy of D (measurement frequency: 1 MHz, 1 MHz \pm 1%, 1 MHz \pm 2%)

D

Measurement time mode (N)	1	2	4	6	8
1 pF	0.00035 + 0.00070 × K	0.00035 + 0.00047 × K	0.00035 + 0.00036 × K	0.00035 + 0.00033 × K	0.00035 + 0.00030 × K
2.2 pF	0.00035 + 0.00045 × K	0.00035 + 0.00032 × K	0.00035 + 0.00025 × K	0.00035 + 0.00022 × K	0.00035 + 0.00020 × K
4.7 pF 10 pF 22 pF 47 pF 100 pF 220 pF 470 pF 1 nF	0.00035 + 0.00030 × K	0.00035 + 0.00022 × K	0.00035 + 0.00018 × K	0.00035 + 0.00016 × K	0.00035 + 0.00015 × K

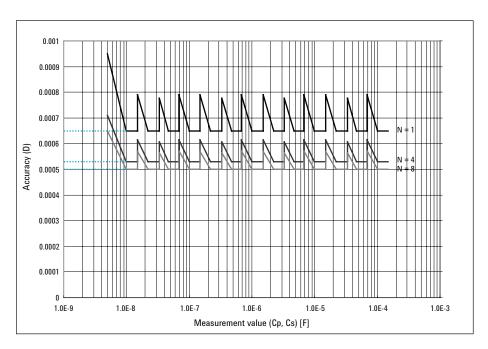


Figure 1. Accuracy of D when measurement frequency is 120 Hz (measurement range: 10 nF to 100 μ F / measurement signal level: 0.5 V)

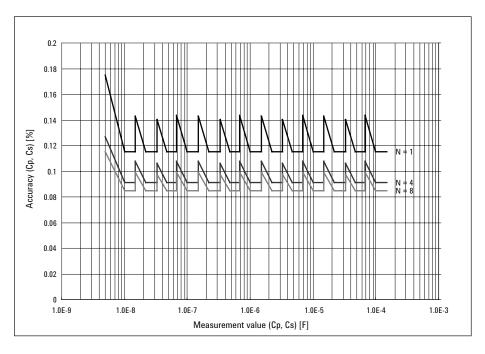


Figure 2. Accuracy of Cp and Cs when measurement frequency is 120 Hz (measurement range: 10 nF to 100 μ F / measurement signal level: 0.5 V)

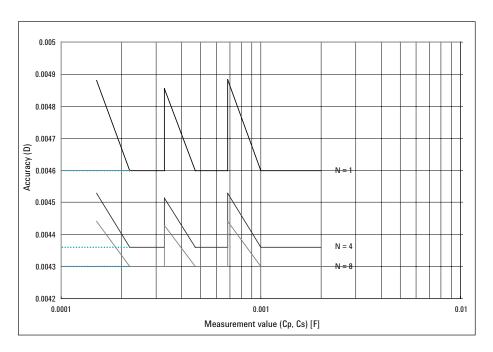


Figure 3. Accuracy of D when measurement frequency is 120 Hz (measurement range: 220 μ F to 1 mF / measurement signal level: 1 V)

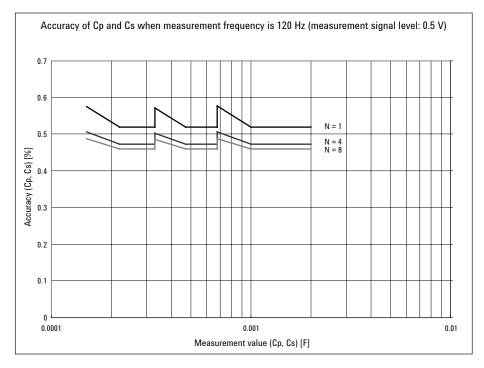


Figure 4. Accuracy of Cp and Cs when measurement frequency is 120 Hz (measurement range: 220 μ F to 1 mF / measurement signal level: 1 V)

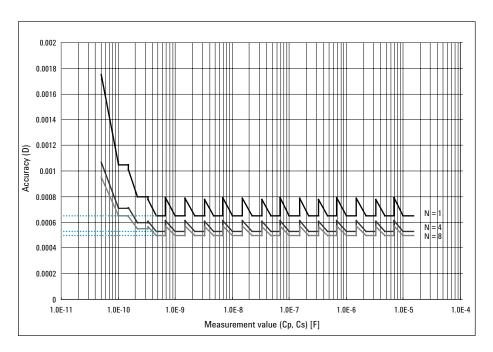


Figure 5. Accuracy of D when measurement frequency is 1 kHz (measurement range: 100 pF to 10 μ F / measurement signal level: 1 V)

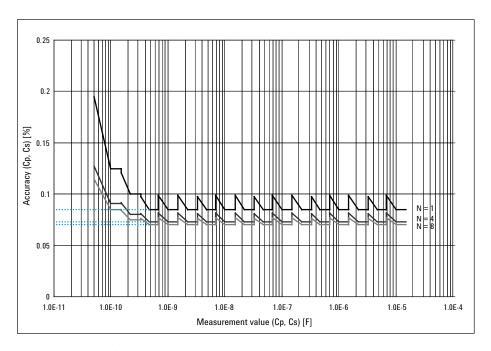


Figure 6. Accuracy of Cp and Cs when measurement frequency is 1 kHz (measurement range: 100 pF to 10 μ F / measurement signal level: 1 V)

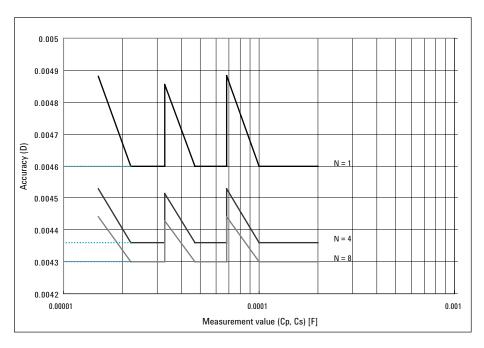


Figure 7. Accuracy of D when measurement frequency is 1 kHz (measurement range: 22 μ F to 100 μ F / measurement signal level: 1 V)

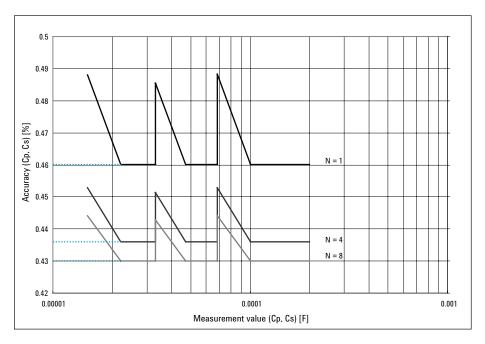


Figure 8. Accuracy of Cp and Cs when measurement frequency is 1 kHz (measurement range: 22 μ F to 100 μ F / measurement signal level: 1 V)

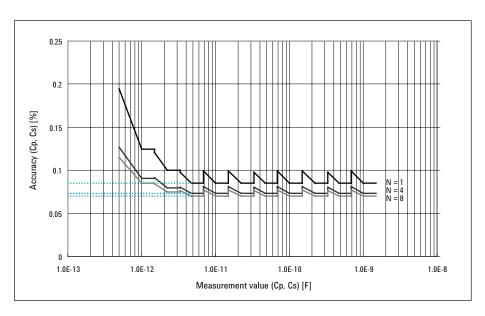


Figure 9. Accuracy of Cp and Cs when measurement frequency is 1 MHz (measurement signal level: 1 V)

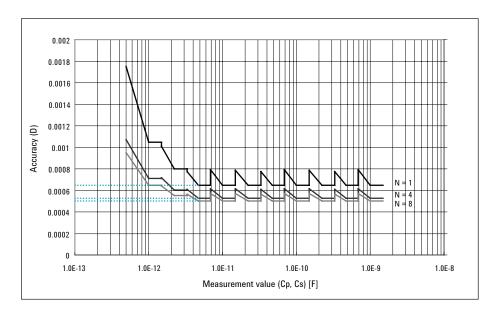


Figure 10. Accuracy of D when measurement frequency is 1 MHz (measurement signal level: 1 V)

Sample calculation of measurement accuracy is described on page 31.

Supplemental Information

Measurement signals

	Frequency: 120 Hz	SLC OFF (≥ 220 µF range) SLC ON (≥ 220 µF range) 2.2 µF to 100 µF range 10 nF to 1 µF range	1.5 Ω (nom.) ¹ 0.3 Ω (nom.) ¹ 0.3 Ω (nom.) ¹ 20 Ω (nom.) ¹
Output impedance	Frequency: 1 kHz	SLC OFF (\geq 22 μ F range) SLC ON (\geq 22 μ F range) 220 nF to 10 μ F range 100 pF to 100 nF range	1.5 Ω (nom.) ¹ 0.5 Ω (nom.) ¹ 0.3 Ω (nom.) ¹ 20 Ω (nom.) ¹
	Frequency: 1 MHz / 1 MHz ± 2% / 1 MHz ± 1%		20 Ω (nom.) ¹

Measurement time

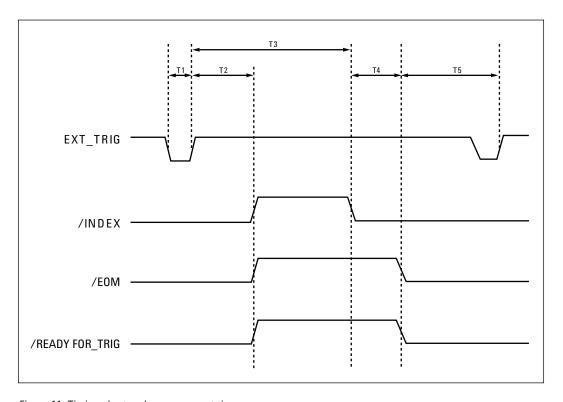


Figure 11. Timing chart and measurement time

^{1.} This value is defined without an extension cable.

Table 14 shows the values of T1-T5 when the following conditions are met:

Display update: OffSynchronous source: On

• Measurement range mode: Hold range mode (Hold)

Source delay time: 0 msTrigger delay time: 0 msAveraging factor: 1

SLC: Off

• Measurement time mode (N): 1

Correction: OnMulti connection: OnLAN: Not connected

Table 14. Values of T1 – T5 (typical)

		Measurement frequency	Minimum value	Typical value
T1				
Trigger pulse width		N/A	1 μs	_
T2				
Trigger response time of /READY_FOR_TRIG, /INDEX and /EOM		N/A	-	40 μs
(T3 + T4)	T3			
Measurement	Analog	120 Hz	_	10.0 ms
time	measurement	1 kHz	_	2.0 ms
	time	1 MHz	_	1.3 ms
(T3 + T4)	T4			
Measurement time	Measurement computation time	N/A	_	1.0 ms
T5				
Trigger wait time		N/A	0 μSec	_

Display time

Except in the case of the DISPLAY BLANK page, the time required to update the display on each page (display time) is as follows (Table 15). When the screen is changed, drawing time and switching time are added. The measurement display is updated about every 100 ms.

Table 15. Display time

Item	Time
MEAS DISPLAY page drawing time	10 ms
MEAS DISPLAY page (large) drawing time	10 ms
BIN No. DISPLAY page drawing time	10 ms
BIN COUNT DISPLAY page drawing time	10 ms
Measurement display switching time	35 ms

Measurement time

Table 16 shows the measurement time (T3 + T4) for each measurement time mode.

Table 16. Measurement time

Frequency	Measurement time [ms]
120 Hz	$(N \times 8.3 \times Ave + 2.7) \pm 0.5$
1 kHz	$(N \times 1.0 \times Ave + 2.0) \pm 0.5$
1 MHz / 1 MHz ± 1% / 1 MHz ± 2%	$(N \times 1.0 \times (100/(100 + Fshift)) \times Ave + 1.3) \pm 0.5$

Measurement time mode (N) = 1, 2, 4, 6, 8

Ave: Averaging factor

Fshift: Frequency shift setting

Measurement data transfer time

Table 17 shows the measurement data transfer time under the following conditions. The measurement transfer time varies with the measurement conditions and computer used.

· Host computer: DELL PRECISION 390, 1.86 GHz/Windows XP

USB GPIB Interface Card: 82350AUSB GPIB Interface: E2078A

· Display: ON

· Measurement range mode: Hold range mode (Hold)

OPEN/SHORT/LOAD correction: OFFMeasurement signal monitor: OFF

· BIN count function: OFF


Table 17. Measurement data transfer time (typical)


	using :FETC? command (one point measurement)			using :READ command (one point measurement)		using data buffer memory (1000 measurement points (BUFFER3))	
Interface	transfer format	Comparator ON [ms]	Comparator OFF [ms]	Comparator ON [ms]	Comparator OFF [ms]	Comparator ON [ms]	Comparator OFF [ms]
	ASCII	1	1	3	3	202	186
GPIB	ASCII Long	1	1	3	3	247	231
	Binary	1	1	3	4	145	111
	ASCII	1	1	4	4	101	94
USB	ASCII Long	1	1	4	4	121	114
	Binary	1	1	4	4	43	33
	ASCII	3	3	5	5	158	146
LAN	ASCII Long	3	3	6	6	193	181
	Binary	5	5	7	7	105	79

Measurement Assistance Functions

Measurement assistance functions

Correction function	 OPEN/SHORT/LOAD Correction are available The OFFSET Correction is available
MULTI Correction function	 OPEN/SHORT/LOAD Correction for 256 channels The LOAD Correction standard value can be defined for each channel
Cable Correction funtion	Cable Correction is available
Deviation measurement function	Deviation from reference value and percentage of deviation from the reference value can be outputted as the result
Comparator function	 BIN sort: The primary parameter can be sorted into 9 BINs, OUT_OF_BINS, AUX_BIN, and LOWC_OR_NC. The secondary parameter can be sorted into High, In, and Low. Limit setup: An absolute value, deviation value, and % deviation value can be used for setup Bin count: Countable from 0 to 999999
Low C reject function	Extremely low measured capacitance values can be automatically detected as measurement errors
Contact check function	The contact check function is available on 120 Hz and 1 kHz
Single Level Compensation	 SLC function compensates the voltage drop by the resistance inside the E4981A and the extension cable under the following frequencies and ranges Measurement cable: 16048A or 16048D When the measurement frequency is 120 Hz: 220 µF range, 470 µF range, 1 mF range When the measurement frequency is 1 kHz: 22 µF range, 47 µF range, 100 µF range

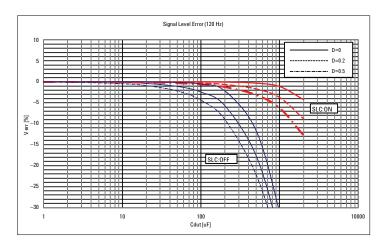

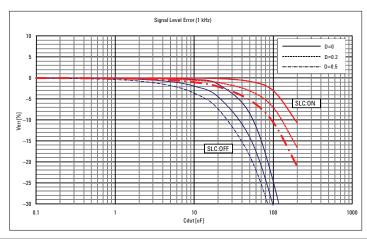

Measurement assistance functions

Measurement signal level monitor function	 Measurement voltage and measurement of Level monitor accuracy (typical): ± (3% + 1) 	
Data buffer function	Up to 1000 measurement results can be read out in batch	
Save/recall function	 Up to 10 setup conditions can be written to/read from the built-in nonvolatile memory Up to 10 setup conditions can be written to/read from the external USB memory Auto recall function can be performed when the setting conditions are written to Register 9 in the built-in non-volatile memory 	
Key lock function	The front panel keys can be locked	
GPIB interface	Complies with IEEE488.1, 2 and SCPI	
USB host port	Universal serial bus jack, type-A (4 contact positions, contact 1 is on your left); connection to USB memory device only	
	 current is below 500 mA Recommended USB memory: 4 GB USB FI Use the prepared USB memory device exc saved data may be cleared. If you use a US may not be saved or recalled normally. 	s, FAT16/FAT32 format; maximum consumption
USB interface port	 Universal serial bus jack, type mini-B (4 contact positions); complies with USBTMC-USB488 and USB 2.0; female; for connection to the external controller. USBTMC: Abbreviation for USB Test & Measurement Class 	
LAN interface	 10/100 BaseT Ethernet, 8 pins; two speed options Compliant with LXI standard (LAN eXtensions for Instrumentation): Version 1.2, Class C Auto MDIX 	
Handler interface	The input/output signals are negative logic and optically isolated open collector signals Output signal: Bin1—Bin9, Out of Bins, Aux Bin, P-Hi, P-Lo, S-Reject, INDEX, EOM, Alarm, OVLD, Low C Reject or No Contact, Ready_For_Trigger Input signal: Keylock, Ext-Trigger	
Scanner interface	The input/output signals are negative logic and optically isolated open collector signals Output signal: INDEX, EOM Input signal: Ch0 — Ch7, Ch valid, Ext-Trigger	
Measurement circuit protection	The maximum discharge withstand voltage, where the internal circuit remains protected if a charged capacitor is connected to the UNKNOWN terminal, is illustrated below. NOTE: Discharge capacitors before connecting them to the UNKNOWN terminal or a test fixture. Table 18. Maximum discharge withstand voltage (typical)	
	Maximum discharge withstand voltage	Range of capacitance value C of DUT
	1000 V	C < 2 μF
	$\sqrt{2/C} V$	C ≥ 2 µF

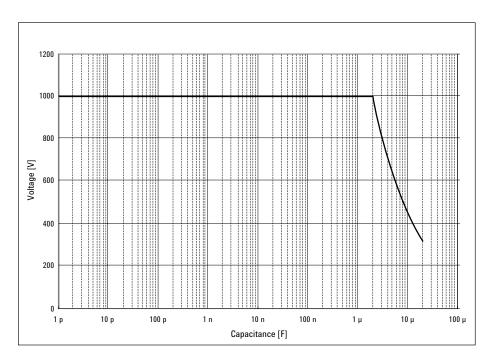


Figure 13. Maximum discharge withstand voltage (typical)

General Specifications

Power source

Voltage	90 VAC to 264 VAC
Frequency	47 Hz to 63 Hz
Power consumption	Maximum 150 VA

Operating environment

Temperature	0 °C to 45 °C
Humidity (≤ 40 °C, no condensation)	15% to 85% RH
Altitude	0 m to 2000 m

Storage environment

Temperature	−20 °C to 70 °C
Humidity (≤ 65 °C, no condensation)	0% to 90% RH
Altitude	0 m to 4572 m

Other

Weight	4.3 kg (nominal)
Display	LCD, 320 x 240 (pixel), RGB color
Outer dimensions	370 (width) x 105 (height) x 405 (depth) mm (nominal)

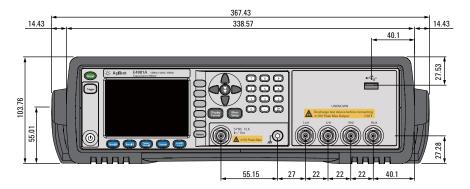


Figure 14. Dimensions (front view, with handle and bumper, in millimeters, nominal)

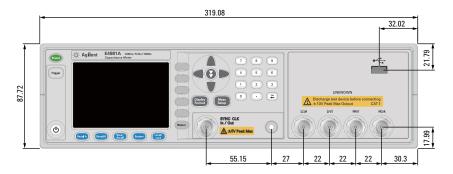


Figure 15. Dimensions (front view, without handle and bumper, in millimeters, nominal)

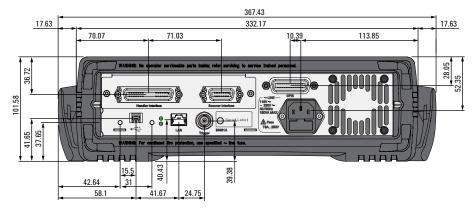


Figure 16. Dimensions (rear view, with handle and bumper, in millimeters, nominal)

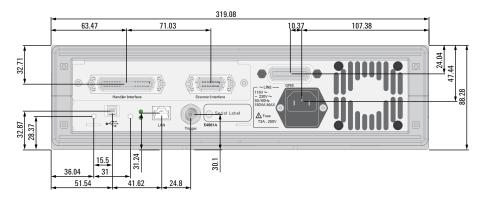


Figure 17. Dimensions (rear view, without handle and bumper, in millimeters, nominal)

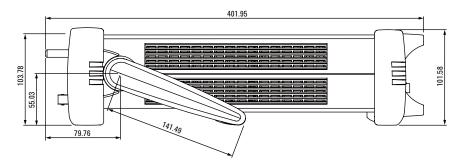


Figure 18. Dimensions (side view, with handle and bumper, in millimeters, nominal)

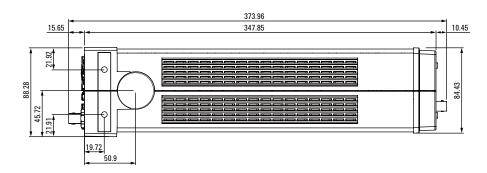


Figure 19. Dimensions (side view, without handle and bumper, in millimeters, nominal)

E	M	C

	European Council Directive 2004/108/EC	
	IEC 61326-1:1997 +A1:1998 +A2:2000 EN 61326-1:1997 +A1:1998 +A2:2001	
	CISPR 11:1997 +A1:1999 +A2:2002 EN 55011:1998 +A1:1999 +A2:2002	Group 1, Class A
	IEC 61000-4-2:1995 +A1:1998 +A2:2001 EN 61000-4-2:1995 +A1:1998 +A2:2001	4 kV CD / 8 kV AD
CE	IEC 61000-4-3:1995 +A1:1998 +A2:2001 EN 61000-4-3:1996 +A1:1998 +A2:2001	3 V/m, 80-1000 MHz, 80% AM
IOM I-A	IEC 61000-4-4:1995 +A1:2001 +A2:2001 EN 61000-4-4:1995 +A1:2001 +A2:2001	1 kV power / 0.5 kV Signal
	IEC 61000-4-5:1995 +A1:2001 EN 61000-4-5:1995 +A1:2001	0.5 kV Normal / 1 kV Common
	IEC 61000-4-6:1996 +A1:2001 EN 61000-4-6:1996 +A1:2001	3 V, 0.15-80 MHz, 80% AM
	IEC 61000-4-11:1994 +A1:2001 EN 61000-4-11:1994 +A1:2001	100% 1cycle
ICES/NMB-001	This ISM device complies with Canadian ICES-001:1998. Cet appareil ISM est conforme à la norme NMB-001 du Canada.	
N 10149	AS/NZS 2064.1	Group 1, Class A
Safety		
	European Council Directive 73/23/EEC, 93/68/EEC	
C € ISM 1-A	IEC 61010-1:2001 EN 61010-1:2001	Measurement Category I Pollution Degree 2 Indoor Use
	IEC60825-1:1994	Class 1 LED
© LR95111C	CAN/CSA C22.2 61010-1-04	Measurement Category I Pollution Degree 2 Indoor Use

WEEE



European Council Directive 2002/96/EC

Sample Calculation of Measurement Accuracy

This section describes an example for calculating the measurement accuracy of each measurement parameter, assuming the following measurement conditions

Sample

· Measurement signal frequency: 1 kHz

• Measurement signal level: 0.5 V

• Measurement range: 10 nF

• Measurement time mode: N = 1

Ambient temperature: 28 °C

When measurement parameter is Cp-D (or Cs-D)

The following is an example for calculating the accuracy of Cp (or Cs) and D, assuming that measured result of Cp (or Cs) is 8.00000 nF and measured result of D is 0.01000.

From Table 7, the equation to calculate the accuracy of Cp (or Cs) is

 $0.055 + 0.030 \times K$

and the equation to calculate the accuracy of D is

 $0.00035 + 0.00030 \times K$

The measurement signal level is 0.5, the measurement range is 10 nF, and the measured result of Cp (or Cs) is 8.00000 nF. Therefore,

 $K = (1/0.5) \times (10/8.00000) = 2.5$

Substitute this result into the equation. As a result, the accuracy of Cp (or Cs) is

 $0.055 + 0.030 \times 2.5 = 0.13\%$

and the accuracy of D is

 $0.00035 + 0.00030 \times 2.5 = 0.0011$

Therefore, the true Cp (or Cs) value exists within

 $8.00000 \pm (8.00000 \times 0.13/100) = 8.00000 \pm 0.0104 \text{ nF}$

that is,

7.9896 nF to 8.0104 nF

and the true D value exists within

 0.01000 ± 0.0011

that is,

0.0089 to 0.0111

When measurement parameter is Cp-Q (or Cs-Q)

The following is an example for calculating the accuracy of Cp (or Cs) and Q, assuming that measured result of Cp (or Cs) is 8.00000 nF and measured result of Q is 20.0.

The accuracy of Cp (or Cs) is the same as that in the example of Cp-D.

From Table 8, the equation to calculate the accuracy of D is

 $0.00035 + 0.00030 \times K$

Substitute K = 2.5 (same as Cp-D) into this equation.

The accuracy of D is

 $0.00035 + 0.00030 \times 2.5 = 0.0011$

Then, substitute the obtained D accuracy into Equation 1. The accuracy of Q is

 $\pm (20.0)^2 \times 0.0011/(1 \mp 20.0 \times 0.0011) = \pm 0.44/(1 \mp 0.022)$

that is.

-0.43 to 0.45

Therefore, the true Q value exists within the range of

19.57 to 20.45

When measurement parameter is $\operatorname{Cp-G}$

The following is an example for calculating the accuracy of Cp and G, assuming that measured result of Cp is 8.00000 nF and measured result of G is 1.00000 μ S.

The accuracy of Cp is the same as that in the example of Cp-D.

From Table 11, the equation to calculate the accuracy of G is

$$(3.5 + 2.0 \times K) \times Cx$$

Substitute K = 2.5 (same as Cp-D) and 8.00000 nF of the measured Cp result into this equation.

The accuracy of G is

$$(3.5 + 2.0 \times 2.5) \times 8.00000 = 68 \text{ nS} (0.068 \mu\text{S})$$

Therefore, the true G value exists within

 $1.00000 \pm 0.068 \, \mu S$

that is.

 $0.932~\mu S$ to $1.068~\mu S$

When measurement parameter is Cp-Rp

The following is an example for calculating the accuracy of Cp and Rp, assuming that measured result of Cp is 8.00000 nF and measured result of Rp is 2.00000 M Ω .

The accuracy of Cp is the same as that in the example of Cp-D.

From Table 11 the equation to calculate the accuracy of G is

$$(3.5 + 2.0 \times K) \times Cx$$

Substitute K = 2.5 (same as Cp-D) and $8.00000 \ nF$ of the measured Cp result into this equation.

The accuracy of G is

$$(3.5 + 2.0 \times 2.5) \times 8.00000 = 68 \text{ nS}$$

Then, substitute the obtained G accuracy into Equation 2. The accuracy of Rp is

$$\pm (2 \times 10^{6})^{2} \times 68 \times 10^{-9} / (1 \mp 2 \times 10^{6} \times 68 \times 10^{-9}) = \pm 0.272 \times 10^{6} / (1 \mp 0.136)$$

that is,

 $-0.23944~\text{M}\Omega$ to $0.31481~\text{M}\Omega$

Therefore, the true Rp value exists within

1.76056 $M\Omega$ to 2.31481 $M\Omega$

When measurement parameter is Cs-Rs

The following is an example for calculating the accuracy of Cp and Rs, assuming that measured result of Cs is 8.00000 nF and measured result of Rs is 4.00000 k Ω .

Because the Cs accuracy is

$$D = 2 \times \pi \times Freg \times Cs \times Rp = 2 \times \pi \times 10^{3} \times 8 \times 10^{-9} \times 4 \times 10^{3} = 0.2 > 0.1$$

multiply 0.13% (the result obtained for Cs-D) by 1 + D2.

The result is

$$0.13 \times (1 + 0.22) = 0.1352\%$$

From Table 11 the equation to calculate the accuracy of Rs is

$$(90 + 50 \times K)/Cx$$

Substitute K = 2.5 (same as Cs-D) and 8.00000 nF of the measured Cs result into this equation.

The accuracy of G is

$$(90 + 50 \times 2.5)/8.00000 = 26.875 \Omega$$

Because D > 0.1, multiply the result by 1 + D2 as in the case of Cs. The final result is 27.95 Ω .

Therefore, the true Cs value exists within

 $8.00000 \pm (8.00000 \times 0.1352/100) = 8.00000 \pm 0.01082 \text{ nF}$

that is.

7.98918 nF to 8.01082 nF

and the true Rs value exists within

 $4.00000 \pm 0.02795 \text{ k}\Omega$

that is,

3.97205 to 4.02795 k Ω



www.agilent.com/find/emailupdates Get the latest information on the products and applications you select.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.

Agilent Channel Partners

www.agilent.com/find/channelpartners
Get the best of both worlds: Agilent's
measurement expertise and product
breadth, combined with channel
partner convenience.



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitve, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com/quality

www.agilent.com

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas	
Canada	(877) 894 4414
Brazil	(11) 4197 3500
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 70 13 15 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 131 452 0200

For other unlisted Countries:

www.agilent.com/find/contactus

Revised: June 8, 2011

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2011 Published in USA, July 26, 2011 5989-8963EN

