# World Class

## Digital 50,000-count TRMS multimeters



### With the ASYC II series, keep metrology within your grasp


- Types of measurement: VAC, AC+DC, IAC, AC+DC,  $\Omega$ , continuity, diode test, capacitance, frequency, temperature, network monitoring, dB
- 0.025% basic accuracy and 100 kHz bandwidth
- Transfer of the measurements onto a PC for processing by capture software (SX-DMM) or directly onto a printer
- Calibration by software (SX-ASYC2C) without having to open up the unit
- Rapid reading with the wide backlit screen and the bargraph
- Elastomer protective sheath and carrying case available as options



## Digital 50,000-count TRMS multimeters

#### High-performance backlighting

MX 54C, MX 55C and MX 56C multimeters are now fitted with backlighting, facilitating reading of measurements in dim light. The sturdiness of the ASYC II instruments makes them ideal for measurement in any kind of environment.



The high 50 mA DC rating accuracy enables standard 4/20 mA signals to be measured. Combined with temperature measurement on the MX 54C by means of a Pt100 or Pt1000 probe, these functions will be of particular interest to the process industry.



#### **Efficient protection**

Designed to resist overloads, all inputs are protected. Current input thus has high cut-out power fuses (HPC) and input voltage con withstand 6 kV/10  $\mu s$  transient pulses without damage.

## Measurement in dB or in VA (resistive power)

Measurement of alternating voltage con be displayed in Volts, in dB or in resistive power. Once the load impedance has been programmed using the keyboard (from 1  $\Omega$  to 9999  $\Omega$ ), the multimeter automatically calculates the value in dB and the power consumed (VA).

#### An advanced safety concept

The ASYC II case has a separate battery/fuse compartment which protects the instrument when a battery or fuse is being replaced and insulating the electronics from any risk of infiltration. The battery compartment lid closes without a screw and can be opened simply by means of the instrument stand. The SECUR'X locking device obliges the user to unplug the leads before opening the case, thus preventing them from being accidentally pulled out.

#### **Current Autoranging**

For the first time, with the ASYC II series, Metrix is offering a 500  $\mu A$  to 500 mA current Autoranging function, With resolution of up to 0.01  $\mu A$ .

#### High accuracy

With a 50,000 count display and basic accuracy of up to 0.025%, the ASYC II series has the highest performance of its generation.

#### True RMS

With the four models, you con measure true RMS, in AC alone or in AC + DC.

#### SX-ASYC2 kit

The SX-ASYC2 kit is an RS 232 interface that enables multimeters to be programmed by remote control.

By means of the RS 232 interface and the "Print" button, measurements can be transmitted manually (Print mode) or automatically (Remote mode) to a PC or a serial printer. A transmission rate of 0 secs (single transmission) to 9 hrs 59 mins 59 secs can be directly defined on the multimeter by the user.







GENERAL CHARACTERISTICS	MX 56C, MX 55C, MX 54C, MX 53C		
Display	50,000 counts (14 mm)		
Bargraph (with zoom mode)	34 segments		
Backlighting	MX 54C, MX 55C, MX 56C		
Measurement rate	Digital displ. 2 meas per sec - bargraph: 20 meas per sec		
AC conversion	True RMS, AC or AC+DC		
Peak factor	6		
IEC 61010-1 safety	Cat.III 600 V		
Pollution degree	2		
C.E.M.	NF EN 55011, class B		
Operating temperature	-10 to 80 °C		
Relative humidity	0 - 80% (0-40 °C): 0 - 70% (40-50 °C)		
Storage temperature	-40 to 70 °C		
Power supply	9 V 6LF22 battery		
Autonomy	500 hrs (Auto. Cut-out: 30 mins)		
Dimensions and weight	40 x 82 x 189 mm, 400 g		
Warranty	3 years		



RACTÉRISTIQUES TECHNIQUES	MX 56C	MX 55C	MX 54C	MX 53C
Direct voltage				
Ranges		0.5 - 5 - 50 - 500 - 1000 V	0.5 - 5 - 50 - 500 - 1000 V	0.5 - 5 - 50 - 500 - 1000 \
Resolution	10 μV to 100 mV	10 μV to 100 mV	10 μV to 100 mV	10 μV to 100 mV
Basic accuracy	0.025% R + 2 D	0.025% R + 2 D	0.05% R + 2 D	0.1%R + 2 D (500mV to 50)
Input impedance	10 MΩ (1 GΩ), 100 pF	10 MΩ (1 GΩ), 100 pF	10 MΩ (1 GΩ), 100 pF	10 MΩ, 100 pF
Alternating voltage				
Ranges	•	0.5 - 5 - 50 - 500 - 750 V		0.5 - 5 - 50 - 500 - 750 \
Resolution	10 μV to 100 mV	10 μV to 100 mV	10 μV to 100 mV	100 μV to 1 V
Bandwidth	DC to 100 kHz	DC à 100 kHz	DC à 100 kHz	DC à 30 kHz
Basic accuracy	0.3%R + 30D	0.3%R + 30D	0.3%R + 30D	1%R + 3D
	(from DC to 1 kHz)	(from DC to 1 kHz)	(from DC to 1 kHz)	(from DC to 1 kHz)
Input impedance	10 MΩ (1 GΩ), 100 pF	10 MΩ (1 GΩ), 100 pF	10 MΩ (1 GΩ), 100 pF	10 MΩ, 100 pF
Direct current				
Ranges	l '	500 μA, 5 - 50 - 500 mA, 10 A	'	
Resolution	10 nA to 1 mA	10 nA to 1 mA	10 nA to 1 mA	100 nA to 1 mA
Basic accuracy	0.05%R + 2D (50 mA)	0.05%R + 2D (50 mA)	0.05%R + 2D (50 mA)	0.2%R + 2D (5 à 500 mA
Alternating current				
Ranges	i	500 μA, 5 - 50 - 500 mA, 10 A	· ·	5 - 50 - 500 mA, 10 A
Resolution	10 nA to 1 mA	10 nA to 1 mA	10 nA to 1 mA	1 μA to 10 mA
Bandwidth	DC to 5 kHz	DC to 5 kHz	DC à 5 kHz	DC à 5 kHz
Basic accuracy	0.6%R + 30D	0.6%R + 30D	0.6 %R + 30D	1%R + 3D
	(500 Ω to 50 mA)	(500 Ω to 50 mA)	(500 Ω to 50 mA)	(5 Ω to 500 mA)
Resistances				
Ranges	0.5 - 5 - 50 - 500 kΩ,	0.5 - 5 - 50 - 500 kΩ,	0.5 - 5 - 50 - 500 kΩ,	0.5 - 5 - 50 - 500 kΩ,
	5 - 50 MΩ	5 - 50 MΩ	5 - 50 MΩ	5 - 50 MΩ
Resolution	10 mΩ to 1 kΩ	10 m $\Omega$ to 1 k $\Omega$	10 m $\Omega$ to 1 k $\Omega$	10 mΩ to 1 kΩ
Dania angurany	0.07%R + 2D	0.07%R + 2D	0.07%R + 2D	0.1%R + 3D
Basic accuracy	(500 Ω to 500 kΩ)	(500 Ω to 500 kΩ)	(500 Ω to 500 kΩ)	(500 Ω to 500 kΩ)
Max. voltage live circuit	7 V	7 V	7 V	7 V
Continuity				
Detection threshold	from 10 to 20 Ω	from 10 to 20 Ω	from 10 to 20 Ω	from 10 to 20 Ω
Response time	1 ms	1 ms	1 ms	1 ms
Diode test				
Diode voltage measurements	from 0 to 1.999 V	from 0 to 1.999 V	from 0 to 1.999 V	from 0 à 1.999 V
Current	1 mA ± 20%	1 mA ± 20%	1 mA ± 20%	1 mA ± 20%
Capacities (5000 cts)				
Ranges	50 - 500 nF, 5 - 50 - 500 μF,	50 - 500 nF, 5 - 50 - 500 μF,	50 - 500 nF, 5 - 50 - 500 μF,	50 - 500 nF, 5 - 50 - 500 μF
	5 - 50 mF	5 - 50 mF	5 - 50 mF	5 - 50 mF
Resolution	10 pF to 10 μF	10 pF to 10 μF	10 pF to 10 μF	10 pF to 10 μF
Basic accuracy	1%R + 2D	1%R + 2D	1%R + 2D	1%R + 2D
Frequencies				
Bandwidth	0.62 Hz to 500 kHz	0.62 Hz à 500 kHz	0.62 Hz to 500 kHz	0.62 Hz to 500 kHz
Sonsitivity	l .	from 2% to 5% of the meas.	from 2% to 5% of the meas.	from 2% to 5% of the meas
Sensitivity	(from 0.62Hz to 50kHz)	(from 0.62Hz to 50kHz)	(from 0.62Hz to 50kHz)	(from 0.62Hz to 50kHz)
Basic accuracy				
-	0.03%R + 1D	0.03%R + 1D	0.03%R + 1D	0.03%R + 1D
Duty cycle	0.03%R + 1D % positive or négative	0.03%R + 1D % positive or négative	0.03%R + 1D % positive or négative	0.03%R + 1D % positive or négative
Duty cycle Event metering	% positive or négative positive or négative			
Duty cycle	% positive or négative			
Duty cycle Event metering Pulse width • Temperature	% positive or négative positive or négative	% positive or négative -		% positive or négative
Duty cycle Event metering Pulse width	% positive or négative positive or négative	% positive or négative -		% positive or négative
Duty cycle Event metering Pulse width • Temperature	% positive or négative positive or négative	% positive or négative - -	% positive or négative - -	% positive or négative
Duty cycle Event metering Pulse width • Temperature Ranges	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative200 to +800°C	% positive or négative
Duty cycle Event metering Pulse width • Temperature Ranges Resolution	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative200 to +800°C 0.1 °C	% positive or négative
Duty cycle Event metering Pulse width • Temperature Ranges Resolution accuracy	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C)	% positive or négative
Duty cycle Event metering Pulse width • Temperature Ranges Resolution accuracy Probes to use	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C  0.1 °C  ±0.5°C (from -125 to +75°C)  Pt100 ou Pt1000  °C or °F	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F > 80 V	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F  > 80 V > 25 V	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise  Bandwidth	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F > 80 V	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F  > 80 V > 25 V	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise  Bandwidth	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F  > 80 V > 25 V	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise  Bandwidth  • dB function	% positive or négative positive or négative positive or négative	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F  > 80 V  > 25 V  1 kHz to 100 kHz	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise  Bandwidth  • dB function  Converts Vac into dB. Resistance	% positive or négative positive or négative positive or négative  > 80 V > 25 V 1 kHz to 100 kHz adjustable	% positive or négative	% positive or négative 200 to +800°C  0.1 °C  ±0.5°C (from -125 to +75°C)  Pt100 ou Pt1000  °C or °F  > 80 V  > 25 V  1 kHz to 100 kHz  adjustable	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution accuracy  Probes to use  Units  • Network monitoring Indication of presence of peaks Indication of presence of noise  Bandwidth  • dB function  Converts Vac into dB. Resistance reference adjustable from 1Ω to 9999 Ω	% positive or négative positive or négative positive or négative  > 80 V > 25 V 1 kHz to 100 kHz  adjustable reference	% positive or négative	% positive or négative200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F > 80 V > 25 V 1 kHz to 100 kHz adjustable reference	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution  accuracy  Probes to use  Units  • Network monitoring  Indication of presence of peaks  Indication of presence of noise  Bandwidth  • dB function  Converts Vac into dB. Resistance reference adjustable from 1Ω to 9999 Ω  Resolution	% positive or négative positive or négative positive or négative  > 80 V > 25 V 1 kHz to 100 kHz  adjustable reference 0.01 dB	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F > 80 V > 25 V 1 kHz to 100 kHz  adjustable reference 0.01 dB	% positive or négative
Duty cycle  Event metering  Pulse width  • Temperature  Ranges  Resolution accuracy  Probes to use  Units  • Network monitoring Indication of presence of peaks Indication of presence of noise  Bandwidth  • dB function  Converts Vac into dB. Resistance reference adjustable from 1Ω to 9999 Ω  Resolution  • Resistive power function*	% positive or négative positive or négative positive or négative  > 80 V > 25 V 1 kHz to 100 kHz  adjustable reference 0.01 dB	% positive or négative	% positive or négative 200 to +800°C 0.1 °C ±0.5°C (from -125 to +75°C) Pt100 ou Pt1000 °C or °F > 80 V > 25 V 1 kHz to 100 kHz  adjustable reference 0.01 dB	% positive or négative

 $<sup>^{\</sup>star}$  Converts Vac+pc (True RMS) into power from 100 µVA to 100 kVA) with a reference resistance adjustable from 1  $\Omega$  to 9999  $\Omega.$ 




## SX-DMM: a control and analysis software package

#### A complete software package

The SX-DMM software enables you to receive, record, represent and exploit measurements from one to four multimeters of the ASYC II.

#### In-depth analysis


Once the results of measurements have been recorded, various mathematical processes enable you to analyse them in more depth as required. You thus have XY, derived, integral and curve smoothing functions at your disposal.

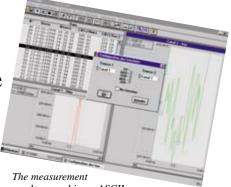

results, saved in an ASCII file, can be called up on the screen and printed at any time.

#### Presentation of measurements

Three presentation modes can be selected. The Graph mode allows any data recorded to be represented in function to time. The instantaneous mode reproduces it in the form of bargraphs. Finally, a third mode enables values to be displayed in the form of a table.

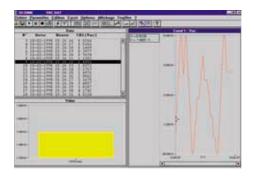

#### SX-DMM and SX-ASYC2C software Minimum configuration

- PC or compatible computer with 80386 or more and 25 MHz minimum clock speed (80486 33 MHz recommended)
- · VGA resolution or higher
- · Mathematical coprocessor
- Min. 4 MB RAM (8 MB recommended)
- · 2.5 MB hard disk capacity free
- Microsoft Windows 3.1 or later.

## SX-ASYC2C: calibrate your instrument without opening it up

#### Reliability and Accuracy

Since all adjusting values are recorded, optimum accuracy is achieved. Once the operation is finished, a measurement statement is issued to evidence resetting of the multimeter specifications.



You can determine the adjustment counts by clicking on the button located to the right of the measurement count in order to validate or inhibit it. Errors are indicated.

#### Gain time

When the verification is finished, a reading statement indicates, as a percentage, the difference between the reference measurement and the one actually read by the multimeter - for each count pre-defined by the user. This difference is then compared to the instrument's tolerances.

The operation is then optimised since only the counts beyond tolerance levels are readjusted.

#### Adjust settings with the case closed

With the new ASYC II series, you no longer have to open the multimeter to change settings. Once the SX-ASYC2 serial interface has been installed on the multimeter, you simply connect the PC and initiate the SX-ASYC2C programme, all the adjustments required are carried out by using the programme and are recorded in the instrument.

#### Accessories and information for ordering

#### Accessories included

Each model is sold with a set of 2 safety leads, a 9V battery (fitted), two spare fuses, a control test certificate and a user's manual.

#### Accessories on option

AE0193 Carrying case AE0227 ASYC case Pt1000 probe for MX 54C HA1263 MC0160B ASYC protection sheath

SX-ASYC2 RS 232 serial link kit HA1327 Serial printer Acquisition software SX-DMM SX-ASYC2C Calibration software

#### To order

MX0053C MX 53C Multimeter MX0054C MX 54C Multimeter MX0055C MX 55C Multimeter MX0056C MX 56C Multimeter MX0053CL MX 53C Multimeter with sheath and case

MX0054CL MX 54C Multimeter with sheath and case

MX 55C Multimeter with MX0055CL sheath and case

MX0056CL MX 56C Multimeter with

sheath and case

Characteristics subject to modifications according to technological developments



6, avenue du Pré de Challes - BP 330 74943 ANNECY-LE-VIEUX Cedex

Tel.: 33 4 50 64 22 22 Fax: 33 4 50 64 22 13

4, rue Georgette Agutte 75876 PARIS Tel.: 33 1 44 85 44 86 Fax: 33 1 46 27 95 59

#### **UNITED KINGDOM**

CA UK Ldt - Metrix Waldeck House - Waldeck Road Maidenhead SL6 8BR

Tel.: (01628) 788 888 Fax: (01628) 628 099

